


**DRY SIEVE ANALYSIS
TEST REPORT**



Project : **Production Testing**
 Location : **416 Acacia Bay Rd, Taupo**
 Client : **Landscaping Direct Ltd**
 Contractor : **Landscaping Direct Ltd**
 Sampled by : **Landscaping Direct Ltd**
 Date sampled : **4/03/2016**
 Sampling method : **Not Stated**
 Sample description : **Scoria - SGC 25/50**
 Sample condition : **moist**

Project No : **289855.16**
 Lab Ref No : **16/075**
 Client Ref No :

Sieve Analysis							
Size (mm)	% Passing	Size (mm)	% Passing	Size (mm)	% Passing	Size (mm)	% Passing
75.00	-	19.00	5	4.75	4	0.425	-
63.00	-	13.20	4	2.36	-	0.300	-
37.50	100	9.50	4	1.18	-	0.150	-
26.50	-	6.70	-	0.600	-	0.075	-

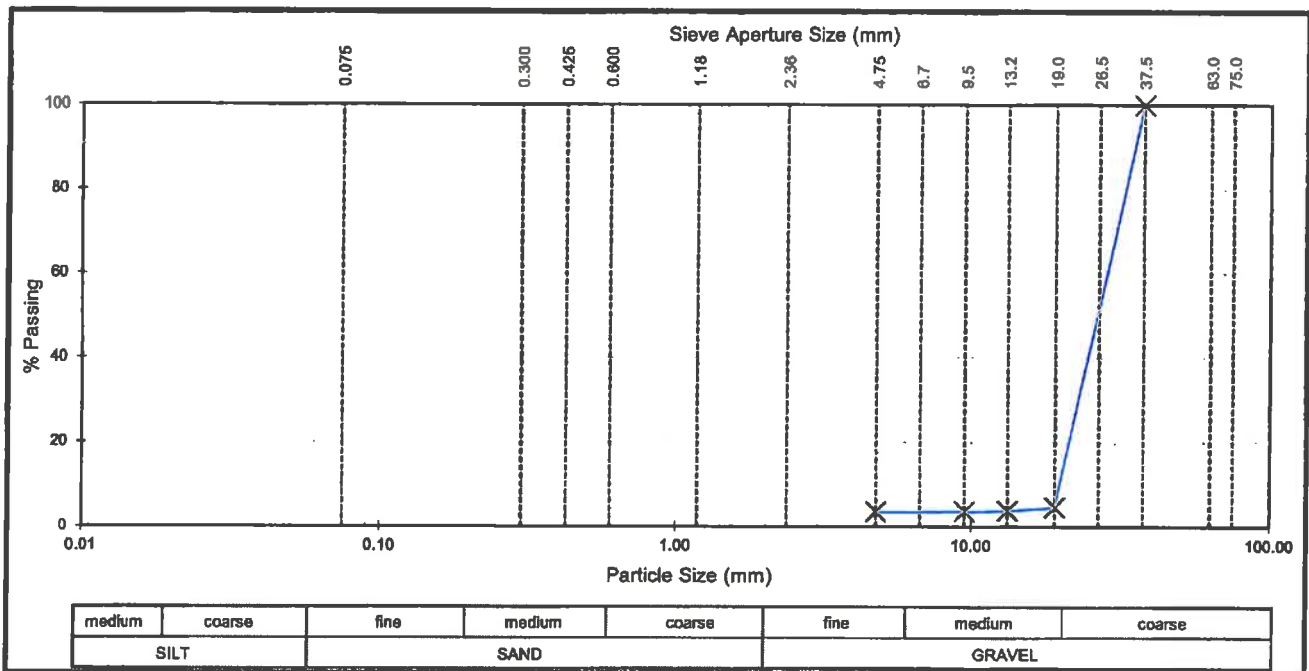

Test Method NZS 4407 : 1991 Test 3.8.2 NZS 3111:1986 (in part) Test 10 - Unit Mass IANZ endorsement applies to Grading only.	Density and Unit Mass Loose Pour Unit Mass = 0.80 t/m3 Water content = 5.5%
---	--

Date tested : 10/03/15 Sampling is not covered by IANZ Accreditation. Results apply only to sample tested.
 Date reported : 15/03/16 This report may only be reproduced in full

IANZ Approved Signatory

Designation : *Laboratory Manager*
 Date : 15/03/16



Tests indicated as not accredited are outside the scope of the laboratory's accreditation